

Date: Friday, 10/13/2006 9:28:59 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : 350 SKIDTUBE ASSEMBLY LH UNDER REVIEW
 Job Number : 28965
 Estimate Number : 10262
 P.O. Number : N/A Part Number : D350636011
 This Issue : 10/13/2006 S.O. No. : N/A Drawing Number : D2750
 Prsht Rev. : NC Project Number : N/A
 First Issue : N/A Type : LANDING GEAR Drawing Revision : D
 Previous Run : 27957 Material : N/A
 Due Date : 11/10/2006 Qty: 1 Um: Each
 Written By :
 Checked & Approved By :
 Comment : Est Rev: I 02.09.25 Rearranged procedure steps KJ
 Est Rev: J 06-03-23 As per Rev D JLM
 Est Rev: J 06-07-13 As per dsi9343 EC

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL
 Photocopy blue file and type labels per PPP D350-636-011 CHG 002

KJ 06-10-17 (1)

2.0 D26003BENT Extrusion Bent



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
 Pick:

Qty Part Number Description Batch
 1 D2600-3-Bent Extrusion (Bent) 629327 IT 06-12-18

3.0 D2744 Fwd Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap
 Batch: 227559 BE 07-01-08

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details).Drill using drill Jig DT8150 & DT8863 drilling holes labelled "A" only.

3- Mark fwd end for cutting using Drill Jig DT 8150 & DT8863 and cut as per dwg D2750.

IT
 06-12-18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/13/2006 9:28:59 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH UNDER REVIEW

Job Number: 23965

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Drill pilot holes for Detail B using DT8330

5-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 and open to 0.250" ***Make sure that wearplate holes are on bottom of tube*****

6-Open up holes of Detail A to 0.250" (total of 2 holes per side)

7- Countersink all fwd wearshoe holes (total of 19 holes per side) DO NOT C'SINK THE LAST AFT HOLES (total of 2 per side for blade fitting) as per dwg D2750.

8-Grind welds flush as per Dwg D2750

9-Open up holes for Detail B, "hole size W" and blade fitting location holes to 0.500" (total of 9 holes per side) as per dwg D2750

10-Weld D2744 Cap as per Dwg D2750 and QSI 004. Fill grooves in bend left from bending as per QSI 004
A/R Aluminum Rod

11-Countersink Detail A as per dwg D2750.

12- Scribe batch# inside per dwg D2750

4T
06-12-18

5.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

BE 07/01/08 (1)

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

B

BE 07/01/08 (1)

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

BE 07-01-08 (1)

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

BE 07/01/08 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/13/2006 9:29:00 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH UNDER REVIEW

Job Number: 28965

Part Number: D350636011

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

9.0	D2739	350 I Beam
-----	-------	------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Web

Batch:

29010

pmc 07-01-08

(1)

10.0	D34901	CROSS BOLT SPACER
------	--------	-------------------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch:

B-29360

BE 07-01-10

11.0	D34903	CROSS BOLT SPACER
------	--------	-------------------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch:

B-29016

BE 07-01-10

12.0	D2743	Crossbolt Spacer
------	-------	------------------



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

Crossbolt Spacer

Batch:

B-29342

BE 07-01-10

13.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
------	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1-Open up holes of Detail V & Detail C to 0.625" (total of 8 holes per side) as per dwg D2750.

pmc 07-01-08 (1)

2-Open up holes of Detail D to 0.750" (total of 4 holes per side) as per dwg D2750.

pmc 07-01-08 (1)

3-Chamfer holes of Detail V, Detail C, Detail D and hole size "W" per dwg D2750 (welding instructions on sheet 4)

pmc 07-01-08

4-Deburr and blow out all chips from inside of tube

pmc 07-01-08 (1)

6-Bond web D2739 in place as per QSI 015

A/R

Sikaflex-291

batch:

exp. date:

07-02-01

m 102 672

pmc 07-01-08

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/13/2006 9:29:00 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH UNDER REVIEW

Job Number: 28965

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

7- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004

(welding instructions on sheet 4)

A/R

Aluminum Rod

batch:

8-Grind welds flush as per Dwg D2750

9-Spot face ground handling holes section J-J (total of 4 places per side) as per dwg D2750

10-Deburr holes

14.0

QC9

VISUAL WELDING INSPECTION

Comment: VISUAL WELDING INSPECTION

15.0

QC5

INSPECT WORK TO CURRENT STEP

Comment: INSPECT WORK TO CURRENT STEP

16.0

POWDER COATING

POWDER COATING

Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION

Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

18.0

NAS1330S3KB166

INSERT

Comment: Qty.: 42.0000 Each(s)/Unit Total: 42.0000 Each(s)

INSERT

Batch:

19.0

HAND FINISHING1

HAND FINISHING RESOURCE #1

Comment: HAND FINISHING RESOURCE #1

Install inserts as per Dwg D2750

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/13/2006 9:29:00 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH UNDER REVIEW

Job Number: 28965

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Inserts

ml 07/01/17

①

21.0

D26483

Wearpad



Comment: Qty.: 5.0000 Each(s)/Unit Total : 5.0000 Each(s)

Wearpad

Batch:

B 28249

22.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch:

B 27739

23.0

D265635

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch:

B 26206

24.0

D2746

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearplate

Batch:

B 28257

25.0

D2745

Bushing



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Bushing

Batch:

B 28974

26.0

D3488041

BLADE FITTING ASSEMBLY, LH



①

Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade Fitting, LH

Batch:

B 28318

ml-r/

07/01/17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/13/2006 9:29:00 AM
User: Kim Johnston.

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH UNDER REVIEW

Job Number: 28965

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

27.0

D3492041

PLUG ASSEMBLY



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: B 29363

28.0

D3492043

PLUG ASSEMBLY



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

PLUG ASSEMBLY

Batch: B 29364

29.0

AN3C5A

Bolt



Comment: Qty.: 38.0000 Each(s)/Unit Total : 38.0000 Each(s)

Bolt

Batch: M 103044

30.0

AN3C6A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M 19522

31.0

AN3C7A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M 102254

32.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M 100736

33.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

BOLT

Batch: M 102180

M. R. / 07/01/17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/13/2006 9:29:00 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH UNDER REVIEW

Job Number: 28965

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

AN960C10L

washer



Comment: Qty.: 46.0000 Each(s)/Unit Total: 46.0000 Each(s)

washer

Batch: M102079

35.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

WASHER

Batch: M100186

36.0

MS210436

NUT



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

NUT

Batch: M102332

37.0

MS21083C8

NUT



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

NUT

Batch: M100186

38.0

NAS1515H3L

WASHER



Comment: Qty.: 46.0000 Each(s)/Unit Total: 46.0000 Each(s)

WASHER

Batch: M102039 15X

~~M100993 31X~~

31X M101542

39.0

NAS1515H8L

WASHER



Comment: Qty.: 10.0000 Each(s)/Unit Total: 10.0000 Each(s)

WASHER

Batch: M102535

M.B/am 07/01/17

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign Objects

2-Spray inside of tube with "LPS-3"

batch:

M101915 M.B/am

07/01/17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/13/2006 9:29:01 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH UNDER REVIEW

Job Number: 28965

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

3-Install blade fitting D3488-041, wearshoes and ground handling hardware as per dwg D2750

SIKA FLEX 241

BATCH: B102672

EXP DATE: 07-02

4-Coat all exposed fasteners with "LPS Procyon"

batch: M101915

M17168 m.a.

M101915

07/01/17

①

41.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

M 07/01/22 ①

42.0

PACKAGING

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

43.0

D2741

Blade



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Blade

Batch: 024521

44.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Washer

Batch: M106186

45.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Nut

Batch: M100186

46.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Bolt

Batch: M102735

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ ☐ Date: 07/01/25
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/13/2006 9:29:01 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY LH UNDER REVIEW

Job Number: 28965

Part Number: D350636011

Job Number:



Seq. #:

Machine Or Operation:

Description :

47.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M102515 ✓

48.0

D34931

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

* Batch: B27835 ✓

49.0

D35321

spacer



Comment: Qty.: 2.0000 (s)/Unit Total : 2.0000 (s)

batch: B27894 ✓

50.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

51.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-011

52.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion







U 07-01-25

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

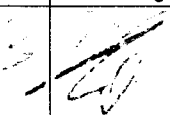QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
								
					803832			
								

NOTE: Date & initial all entries



DESIGN <i>PH</i>	DRAWN BY <i>PH</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2750	REV. D SHEET 1 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY SCALE NTS	
A	98.04.16	NEW ISSUE	
B	98.09.01	CHANGE MS24694-S293 TO AN8-16A	
C	98.11.18	ADD D2750-3/D2750-4 INCORPORATE D2738 AND D2740	
D	06.01.05	ADD HOLES AND SPACERS FOR APICAL FLOATS INCORPORATE DEO 9133/9157	

RELEASED
06.02.07 *PH*

Qty -041	Qty -042	Qty -043	Qty -044	Part Number	Description
X				D2750-041	SKIDTUBE ASSEMBLY, LH
	X			D2750-042	SKIDTUBE ASSEMBLY, RH
		X		D2750-043	SKIDTUBE ASSEMBLY, LH
			X	D2750-044	SKIDTUBE ASSEMBLY, RH
5	5	5	5	D2648-3	WEARPAD
1	1	1	1	D2656-13	WEARSHOE
1	1	1	1	D2656-35	WEARSHOE
1	1	1	1	D2746	WEARSHOE
1	1	1	1	D2739	WEB
1	1	1	1	D2741	BLADE
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
38	38	38	38	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN3C7A	BOLT
4	4	4	4	AN6C44A	BOLT
2	2	2	2	AN8C21A	BOLT
1	1	1	1	AN8C35A	BOLT
46	46	46	46	AN960C10L	WASHER
4	4	4	4	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
3	3	3	3	MS21083C8	NUT
42	42	42	42	NAS1330S3KB166	INSERT
46	46	46	46	NAS1515H3L	WASHER
12	12	12	12	NAS1515H8L	WASHER

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 28965

Copyright © 1998 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DART

DESIGN PH	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED PH	APPROVED PH	DRAWING NO. D2750	REV. D SHEET 2 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS

RELEASED
06.02.07GENERAL NOTES:

 
 
1. ALL DIMENSIONS ARE IN INCHES
2. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
3. MAKE FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
4. DAMAGE TOLERANCE ON BENDING:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 12 INCHES ABOVE THE GROUND. NO GOUGING IS ACCEPTABLE IN THE FLAT PORTION OF THE TUBE. GOUGES UP TO 0.020 ARE ACCEPTABLE IN THE BENT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.150 ± 0.010 IN THE FLAT PORTION OF THE TUBE. TUBE O.D. SHOULD BE 3.15 ± 0.030 IN THE BENT PORTION OF THE TUBE.
5. ALL HOLES DRILLED ON CENTERLINES EXCEPT THOSE NOTED BY SECTIONS E-E, F-F, AND R-R.
6. WELDING TO BE DONE PER DART QSI 004.
7. FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:
MINIMUM YIELD TENSILE STRENGTH = 35 ksi
MINIMUM ULTIMATE TENSILE STRENGTH = 38 ksi
8. FINISH:
ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
9. INSTALL NAS1330S3KB166 INSERTS AFTER FINISH AS INDICATED IN D2750-1/-2/-3/-4 WELDING DETAIL ON PAGE 4 AND 5. DRILL 'E' SIZE HOLES ($\emptyset 0.250$ - $\emptyset 0.257$) FOR WEARSHOE INSERTS. C'SINK $\emptyset 0.391 \times 100^\circ$ AND INSTALL INSERTS
10. D3488-041 (OR D3488-042) BLADE FITTING AND AN3-5A/AN3-7A WEARSHOE SCREWS TO BE INSTALLED USING SIKAFLEX-241 (OR EQUIVALENT) SEALANT.
11. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
12. APPLY A LAYER OF SIKAFLEX -241/-291 ADHESIVE BETWEEN THE BOTTOM OF THE SKIDTUBE ASSEMBLY AND THE WEARPLATES

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
28965

Copyright © 1998 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

02-07-78



SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 28765

0.83

2.770

DETAIL A

1.180 3.150 1.180

DETAIL B

 
1.180 3.150 1.180

DETAIL C


$\phi 0.500^{+0.010}_{-0.000}$
(8 PLACES)


$\phi 0.625$
(8 PLACES)



- DRILL 'E' (Ø0.250-Ø0.257) WEARSHOE HOLES
USING DRILL TEMPLATE DT8108-1
PER SECTION F-F (42 PLACES).
USE DT8108-2 FOR D2750-2. 1.770
C'SINK Ø0.391x100° WEARSHOE HOLES
(38 PLACES)
DO NOT C'SINK D3488-041/-042 HOLES




SECTION F-F

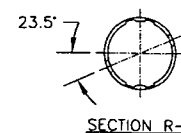

COPYRIGHT © 1988 BY DART AEROSPACE USA, INC.		DESIGN PH	DRAWN BY PH	 DART AEROSPACE USA, INC. PORT HADLOCK, WA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE REPRODUCED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED #	APPROVED #	DRAWING NO. D2750	REV. 0 SHEET 3 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY SCALE 1:20			

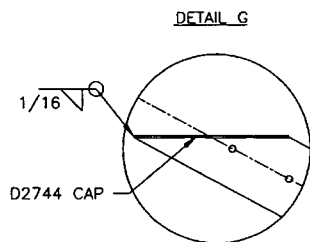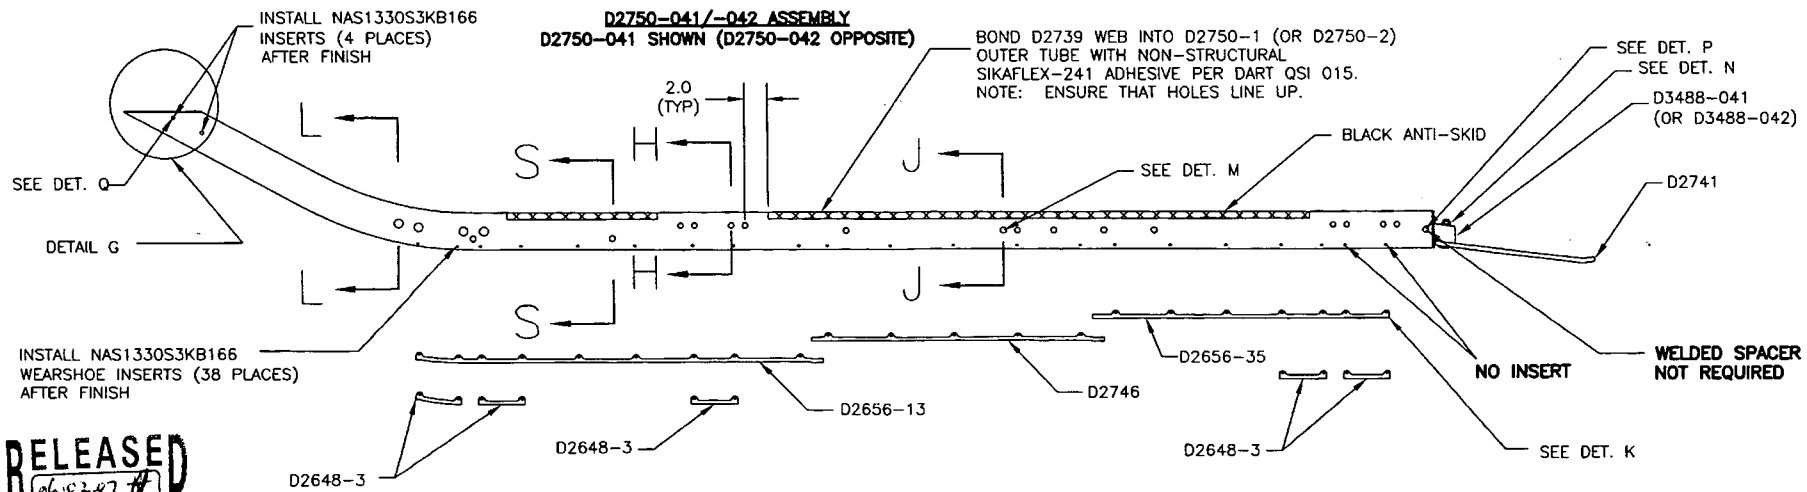


SECTION H-H D2743 SPACER (REF)

 

- WELDING INSTRUCTIONS**
1. CHAMFER HOLE 0.050 X 45°
 2. INSERT D2743 SPACER
 3. WELD INTO PLACE
 4. GRIND FLUSH
 5. DRILL OUT SPACER TO Ø0.484
 6. SPOT FACE Ø0.750 (SECTION J-J ONLY)

DETAIL M

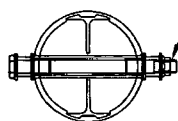

- AN6-44A BOLT (1)
 D2745 BUSHING (2)
 NAS1515H8L WASHER (2)
 MS21043-6 NUT (1)
 (4 PLACES)
NOTE: INSTALL WASHER BETWEEN SKIDTUBE AND BUSHING


DETAIL K



- USE AN3C7A BOLTS FOR INSTALLING AFT D2648-3 WEARPAD (4 PLACES)


- AN3C5A BOLT (1)
 AN960JD10L WASHER (1)
 NAS1515H3L WASHER (1)
 (38 PLACES)

DETAIL P

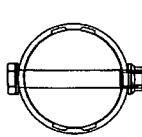



- AN8C35A BOLT (1)
 AN960C816L WASHER (2)
 NAS1515H8L WASHER (2)
 MS21083C8 NUT (1)

DETAIL Q

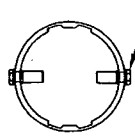

- AN3C6A BOLT (1)
 AN960C10L WASHER (2)
 NAS1515H3L WASHER (2)
 (4 PLACES)

UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 WORK ORDER
 NO. 28765

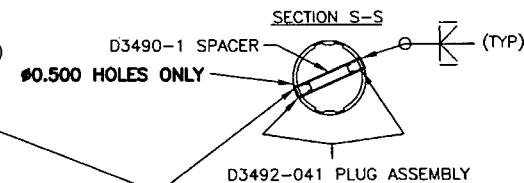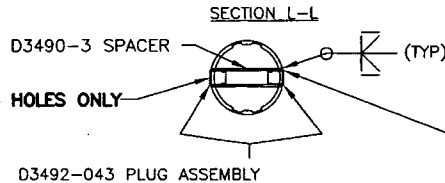

- WELDING INSTRUCTIONS**
1. CHAMFER HOLE 0.050 X 45°
 2. INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES OR INSERT D3490-3 SPACER (4 PLACES) INTO Ø0.750 HOLES
 3. WELD INTO PLACE
 4. GRIND FLUSH
 5. INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER OR INSERT D3492-043 PLUG ASSEMBLY (8 PLACES) INTO D3490-3 SPACER ON BOTH ENDS


COPYRIGHT © 1995 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN PH	DRAWN BY PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	REV. 0
CHECKED #	APPROVED #	DRAWING NO. D2750	SHEET 4 OF 5
DATE 06.01.05	TITLE 350 SKIDTUBE ASSEMBLY	SCALE 1:20	


D2750-043/-044 ASSEMBLY
D2750-043 SHOWN (D2750-044 OPPOSITE)

BOND D2739 WEB INTO D2750-3 (OR D2750-4)
 OUTER TUBE WITH NON-STRUCTURAL
 SIKAFLEX-241 ADHESIVE PER DART OSI 015.
 NOTE: ENSURE THAT HOLES LINE UP.


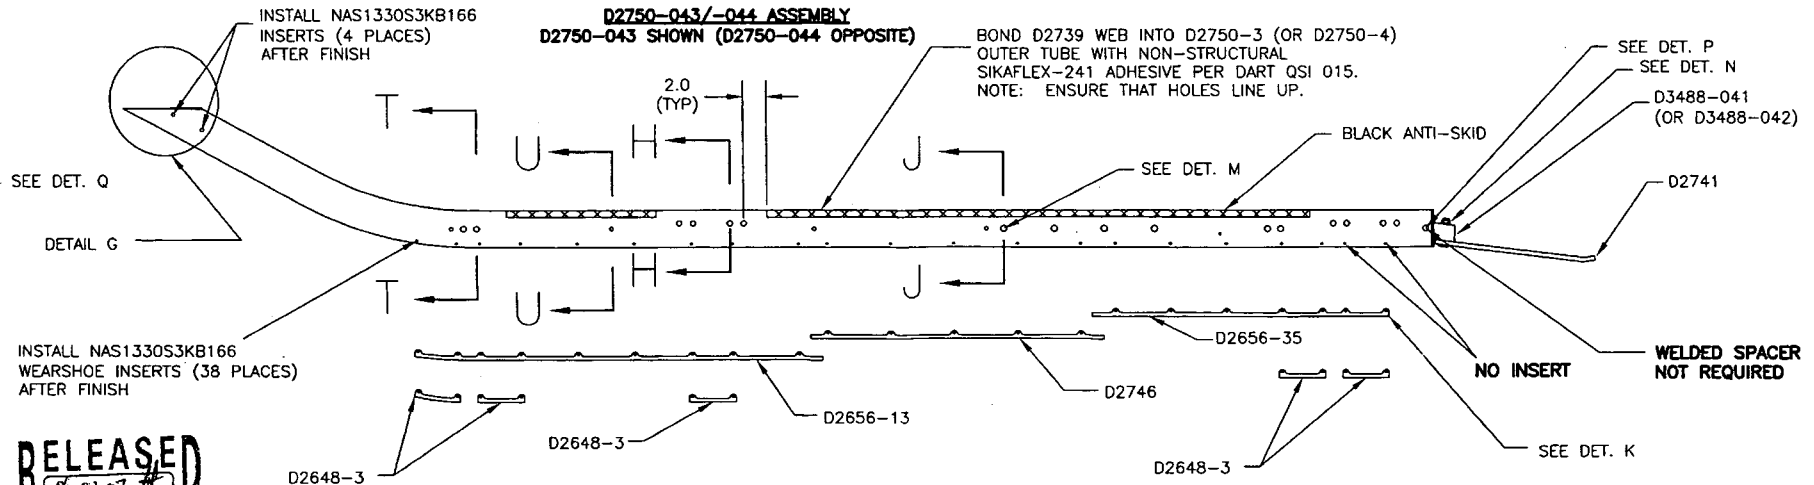


RELEASED
 06-01-07-11

DETAIL G

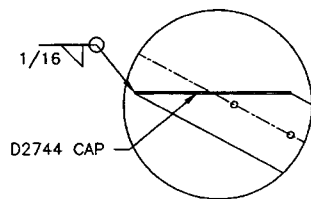

SECTION H-H D2743 SPACER (REF)

  


- WELDING INSTRUCTIONS**
1. CHAMFER HOLE 0.050 X 45°
 2. INSERT D2743 SPACER
 3. WELD INTO PLACE
 4. GRIND FLUSH
 5. DRILL OUT SPACER TO Ø0.484
 6. SPOT FACE Ø0.750 (SECTION J-J ONLY)

SECTION T-T



 SECTION U-U




DETAIL K



USE AN3C7A BOLTS
 FOR INSTALLING AFT
 D2648-3 WEARPAD
 (4 PLACES)


AN3C5A BOLT (1)
 AN960C10L WASHER (1)
 NAS1515H3L WASHER (1)
 (38 PLACES)

DETAIL P

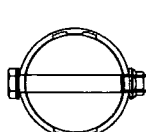


AN8C35A BOLT (1)
 AN960C816L WASHER (2)
 NAS1515H8L WASHER (2)
 MS21083C8 NUT (1)

DETAIL M

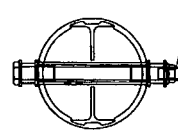


AN6C44A BOLT (1)
 D2745 BUSHING (2)
 NAS1515H8L WASHER (2)
 MS21043-6 NUT (1)
 (4 PLACES)
 NOTE: INSTALL WASHER BETWEEN
 SKIDTUBE AND BUSHING

DETAIL Q

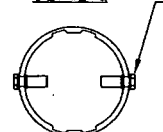

AN3C6A BOLT (1)
 AN960C10L WASHER (1)
 NAS1515H3L WASHER (1)
 (4 PLACES)

DETAIL N

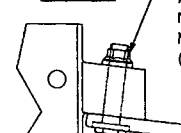

AN8C21A BOLT (1)
 AN960JD816L WASHER (1)
 NAS1515H8L WASHER (1)
 MS21083C8 NUT (1)
 (2 PLACES)

WELDING INSTRUCTIONS

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D3490-5 SPACER (4 PLACES) INTO Ø0.313 HOLES OR INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES
3. WELD INTO PLACE
4. GRIND FLUSH
5. INSERT D3492-045 PLUG ASSEMBLY (8 PLACES) INTO D3490-5 SPACER OR INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER ON BOTH ENDS

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
 AND IS SUPPLIED ON THE EXPRESS CONDITION
 THAT IT IS NOT TO BE USED FOR ANY PURPOSE
 OR COPIED OR COMMUNICATED TO ANY OTHER
 PERSON WITHOUT WRITTEN PERMISSION FROM
 DART AEROSPACE USA, INC.

DESIGN	DRAWN BY	DART	DART AEROSPACE USA, INC.
PH	PH		PORT HADLOCK, MA
CHECKED	APPROVED	DRAWING NO.	REV. D
#	#	D2750	SHEET 5 OF 5
DATE	TITLE	SCALE	
06.01.05	350 SKIDTUBE ASSEMBLY	1:20	

NO. 28965
 WORK ORDER
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 UNCONTROLLED COPY
 ENGINEERING
 RETURN TO
 SHOP COPY

NO. 82

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number A350 636 011/B29428

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input checked="" type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input checked="" type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input checked="" type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input checked="" type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into _____ Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 06/12/18 Qualifier David Arenal